



**Audi**

Please give copies to  
all your Audi Technicians

# Important! Technical Bulletin

Subject: Driveline, Vibration on Deceleration

Group: 30

Number: 01-01

Model(s): TT All Wheel Drive

see VIN below

Date: Apr. 9, 2001

## Condition

Vibration felt down the center of vehicle on deceleration.

May be caused by a faulty dual mass flywheel.

## Production

Improved dual mass flywheel installed as of VIN: 8N\_Y1027001.

## Service

For vehicles up to VIN: 8N\_Y1027000.

If Technician disconnects the Haldex coupling and vibration is gone:

DO NOT replace the Haldex coupling unit. This condition may not be eliminated by replacing the Haldex unit.

- Replace dual mass flywheel with Part No: 06A105266P (see Repair Manual, Group - 13 "Dual mass flywheel, removing and installing").

Only improved service parts are available from the Parts Depots.

### **CAUTION!**

***Part numbers are for reference only. Always check with your Parts Dept. for the latest parts information.***

**C 30-01-01**